New Hampshire Volunteer Lake Assessment Program

2002 Interim Report for Rockwood Pond Fitzwilliam



NHDES Water Division Watershed Management Bureau 6 Hazen Drive Concord, NH 03301



OBSERVATIONS & RECOMMENDATIONS

After reviewing data collected from **ROCKWOOD POND**, the program coordinators recommend the following actions.

We would like to encourage your monitoring group to conduct more sampling events in the future. Typically we recommend that each monitoring group sample at least three times per summer (once in June, July, and August). We understand that the number of sampling events you decide to conduct per summer will depend upon volunteer availability and your associations' water monitoring goals and funding availability. However, with a limited amount of data it is difficult to determine accurate and representative lake quality trends. Since weather patterns and activity in the watershed can change throughout the summer, and from year to year (and even from hour to hour during a rain event), it is a good idea to sample more than once or twice over the course of the season. If you are having difficulty finding volunteers to help sample, or to pick-up or drop-off equipment at one of the labs, please give the VLAP Coordinator a call and we will try to help you work out an arrangement.

If your association's sampling events this year were limited due to not having enough time to pick-up or drop-off samples at the lab in Concord, please remember that the Franklin Pierce College Water Quality Lab is open at the college in Rindge. This lab was established to reduce the driving time for the VLAP monitors in the southwestern region of the state. This lab is inspected by DES and operates under a DES approved quality assurance plan. We encourage the lake association to utilize this lab next summer for all sampling events (except for our annual visit, of course!). To find out more about the lab, or to schedule dates to pick up bottles and equipment, please call the lab manager, at (603) 899-1045.

FIGURE INTERPRETATION

Figure 1 and Table 1: The graphs in Figure 1 (Appendix A) show the historical and current year chlorophyll-a concentration in the water column. Table 1 (Appendix B) lists the maximum, minimum, and mean concentration for each sampling season that the lake/pond has been monitored through the program.

Chlorophyll-a, a pigment naturally found in plants, is an indicator of the algal abundance. Because algae are usually microscopic plants that contain chlorophyll-a and are naturally found in lake ecosystems, the chlorophyll-a concentration found in the water gives an estimation of the concentration of algae or lake productivity. The mean (average) summer chlorophyll-a concentration for New Hamsphire's lakes and ponds is 7.02 ug/L.

Similar to the summer of 2001, the summer of 2002 was filled with many warm and sunny days and there was a lower than normal amount of rainfall during the latter-half of the summer. The combination of these factors resulted in relatively warm surface waters throughout the state. The lack of fresh water to the lakes/ponds reduced the rate of flushing which may have resulted in water stagnation. Due to these conditions, many lakes and ponds experienced increased algae growth, including filamentous green algae (the billowy clouds of green algae typically seen floating near shore), and some lakes/ponds experienced nuisance cyanobacteria (blue-green algae) blooms.

The current year data (the upper graph) show that the chlorophyll-a concentration in July was *much less than* the state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) shows **a decreasing** in-lake chlorophyll-a trend, meaning that the concentration has **improved** since monitoring began in 1994. However, since the pond was not sampled during 1996 – 2000, it is important to note that this trend is based on a limited data set.

After at least 10 consecutive years of sample collection, we will conduct a statistical analysis of the data. This will allow us to objectively determine if there has been a significant change in the annual mean chlorophyll-a concentration since monitoring began.

While algae are naturally present in all lakes/ponds, an excessive or increasing amount of any type is not welcomed. In freshwater lakes/ponds, phosphorus is the nutrient that algae depend upon for growth. Therefore, algal concentrations may increase when there is an increase in nonpoint sources of nutrient loading from the watershed, or in-lake sources of phosphorus loading (such as phosphorus releases from the sediments). It is important to continually educate residents about how activities within the watershed can affect phosphorus loading and lake quality.

Figure 2 and Table 3: The graphs in Figure 2 (Appendix A) show historical and current year data for lake/pond transparency. Table 3 lists the maximum, minimum and mean transparency data for each

sampling season that the lake/pond has been monitored through the program.

Volunteer monitors use the Secchi-disk, a 20 cm disk with alternating black and white quadrants, to measure water clarity (how far a person can see into the water). Transparency, a measure of water clarity, can be affected by the amount of algae and sediment from erosion, as well as the natural colors of the water. **The mean (average) summer transparency for New Hampshire's lakes and ponds is 3.7 meters.**

Two different weather related patterns occurred this past spring and summer that influenced lake quality during the summer season.

In late May and early June of 2002, numerous rainstorms occurred. Stormwater runoff associated with these rainstorms may have increased phosphorus loading, and the amount of soil particles washed into waterbodies throughout the state. Some lakes and ponds experienced lower than typical transparency readings during late May and early June.

However, similar to the 2001 sampling season, the lower than average amount of rainfall and the warmer temperatures during the latter-half of the summer resulted in a few lakes/ponds reporting their best-ever Secchi-disk readings in July and August (a time when we often observe reduced clarity due to increased algal growth)!

The current year data (the upper graph) show that the transparency in July was **approximately equal to** the state mean.

Overall, visual inspection of the historical data trend line (the bottom graph) shows **a slightly increasing** trend for in-lake transparency, meaning that the transparency has **slightly improved** since monitoring began in 1994. Again, please remember that this trend is based on a limited data set. As your association expands its monitoring program to include additional sampling events per season, we will be able to determine long-term trends with more accuracy and confidence.

As discussed previously, after at least 10 consecutive years of sample collection for the lake/pond, we will conduct a statistical analysis of the historic data to determine long-term trends in lake quality.

Typically, high intensity rainfall causes erosion of sediments into the lake/pond and streams, thus decreasing clarity. Efforts should continually be made to stabilize stream banks, lake/pond shorelines, disturbed soils within the watershed, and especially dirt roads located immediately adjacent to the edge of tributaries and the lake/pond. Guides to Best Management Practices designed to reduce, and

possibly even eliminate, nonpoint source pollutants are available from NHDES upon request.

Figure 3 and Table 8: The graphs in Figure 3 (Appendix A) show the amounts of phosphorus in the epilimnion (the upper layer) and the hypolimnion (the lower layer); the inset graphs show current year data. Table 8 (Appendix B) lists the annual maximum, minimum, and median concentration for each deep spot layer and each tributary since the lake/pond has joined the program.

Phosphorus is the limiting nutrient for plant and algae growth in New Hampshire's freshwater lakes and ponds. Too much phosphorus in a lake/pond can lead to increases in plant and algal growth over time. The median summer total phosphorus concentration in the epilimnion (upper layer) of New Hampshire's lakes and ponds is 11 ug/L. The median summer phosphorus concentration in the hypolimnion (lower layer) is 14 ug/L.

The current year data for the epilimnion (upper layer) and the hypolimnion (the lower layer) show that the total phosphorus concentration in July was *less than* the state median

Overall, visual inspection of the historical data trend line for the epilimnion and the hypolimnion shows **a slightly decreasing** phosphorus trend, which means that the concentration has **slightly improved** since monitoring began. We hope this continues!

One of the most important approaches to reducing phosphorus loading to a waterbody is to continually educate watershed residents about its sources and how excessive amounts can adversely impact the ecology and value of lakes and ponds. Phosphorus sources within a lake or pond's watershed typically include septic systems, animal waste, lawn fertilizer, road and construction erosion, and natural wetlands. If you would like to educate watershed residents about how they can help to reduce phosphorus loading into the lake/pond, please contact the VLAP Coordinator.

TABLE INTERPRETATION

> Table 2: Phytoplankton

Phytoplankton populations undergo a natural succession during the growing season (Please refer to page 12 of the "Biological Monitoring Parameters" section of this report for a more detailed explanation regarding seasonal plankton succession). Diatoms and golden-brown algae are typical in New Hampshire's less productive lakes and ponds. An overabundance of cyanobacteria (previously referred to as bluegreen algae) indicates that there may be an excessive total

phosphorus concentration in the lake/pond, or that the ecology is out of balance.

> Table 2: Cyanobacteria

Small amounts of the cyanobacterium **Anabaena** was observed in the plankton sample this season. **If present in large amounts, this species can be toxic to livestock, wildlife, pets, and humans** (Refer to page 14 of the "Biological Monitoring Parameters" section of this report for a more detailed explanation). Cyanobacteria can reach nuisance levels when excessive nutrients and favorable environmental conditions occur.

As with the summer of 2001, we observed that some lakes and ponds had cyanobacteria present during the 2002 summer season, likely due to the many warm and sunny days that occurred this summer, which may have accelerated algal and bacterial growth. In addition, the lower than normal amount of rainfall during the latter half of the summer, meant that the slow flushing rates resulted in less phosphorus exiting the lake outlet and more phosphorus being available for plankton growth.

The presence of cyanobacteria serves as a reminder of the lake's/pond's delicate balance. Watershed residents should continue to act proactively to reduce nutrient loading into the lake/pond by eliminating fertilizer use on lawns, keeping the lake/pond shoreline natural, re-vegetating cleared areas within the watershed, and properly maintaining septic systems and roads.

In addition, residents should also observe the lake/pond in September and October during the time of fall turnover (lake mixing) to document any blooms that may occur. Cyanobacteria have the ability to regulate their depth in the water column by producing or releasing gas from vesicles. However, occasionally lake mixing can affect their buoyancy and cause them to rise to the surface and bloom. Wind and currents tend to "pile" cyanobacteria into "surface scums" that accumulate in one section of the lake/pond. If a fall bloom occurs, please contact the VLAP Coordinator.

> Table 4: pH

Table 4 (Appendix B) presents the in-lake and tributary current year and historical pH data.

pH is measured on a logarithmic scale of 0 (acidic) to 14 (basic). pH is important to the survival and reproduction of fish and other aquatic life. A pH below 5.5 severely limits the growth and reproduction of fish. A pH between 6.5 and 7.0 is ideal for fish. The mean pH value for the epilimnion (upper layer) in New Hampshire's

lakes and ponds is 6.5, which indicates that the surface waters in state are slightly acidic. For a more detailed explanation regarding pH, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

Due to the presence of granite bedrock in the state and the deposition of acid rain, there is not much that can be done to effectively increase lake/pond pH.

> Table 5: Acid Neutralizing Capacity

Table 5 in Appendix B presents the current year and historic epilimnetic ANC for each year the lake/pond has been monitored through VLAP.

Buffering capacity or ANC describes the ability of a solution to resist changes in pH by neutralizing the acidic input to the lake. For a more detailed explanation, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

> Table 6: Conductivity

Table 6 in Appendix B presents the current and historic conductivity values for tributaries and in-lake data. Conductivity is the numerical expression of the ability of water to carry an electric current. For a more detailed explanation, please refer to page 16 of the "Chemical Monitoring Parameters" section of this report.

> Table 8: Total Phosphorus

Table 8 in Appendix B presents the current year and historic total phosphorus data for in-lake and tributary stations. Phosphorus is the nutrient that limits the algae's ability to grow and reproduce. Please refer to page 17 of the "Chemical Monitoring Parameters" section of this report for a more detailed explanation.

The total phosphorus concentration was *elevated* in the **Holman** Inlet this season. This station has had a history of *fluctuating* total phosphorus concentrations. We recommend that your monitoring group conduct stream surveys and stormwater sampling along this inlet so that we can determine what may be causing the increases. For a detailed explanation on how to conduct a stream survey and stormwater sampling, please refer to this year's "Special Topic Article" which is included in Appendix D of this report.

The total phosphorus concentration in the **Tommila Inlet** was slightly elevated on the **July** sampling event. The turbidity of the sample was also elevated (2.9 NTUs), which suggests that the stream bottom may have been disturbed while sampling (Table 11). When

the stream bottom is disturbed, sediment, which typically contains attached phosphorus, is released into the water column. When collecting samples in the inlets, please be sure to sample where there the stream is flowing and where the stream is deep enough to collect a "clean" sample.

> Table 9 and Table 10: Dissolved Oxygen and Temperature Data

Table 9 in Appendix B shows the dissolved oxygen/temperature profile(s) for the 2002 sampling season. Table 10 shows the historical and current year dissolved oxygen concentration in the hypolimnion (lower layer). The presence of dissolved oxygen is vital to fish and amphibians in the water column and also to bottom-dwelling organisms. Please refer to the "Chemical Monitoring Parameters" section of this report for a more detailed explanation.

The dissolved oxygen concentration was **low in bottom meter of the hypolimnion** at the deep spot of the lake/pond. As stratified lakes/ponds age, oxygen becomes **depleted** in the hypolimnion (the lower layer) by the process of decomposition. Specifically, the loss of oxygen in the hypolimnion results primarily from the process of biological breakdown of organic matter (i.e.; biological organisms use oxygen to break down organic matter), both in the water column and particularly at the bottom of the lake/pond where the water meets the sediment. When oxygen levels are depleted to less than 1 mg/L in the hypolimnion (as it was this season and in past seasons), the phosphorus that is normally bound up in the sediment may be rereleased into the water column.

The **low** oxygen level in the hypolimnion is a sign of the lake's/pond's **aging** and **declining** health. This year the DES biologist conducted the temperature/dissolved oxygen profile in **July**. We recommend that the annual biologist visit for the 2003 sampling season be scheduled during **June** so that we can determine if oxygen is being depleted in the hypolimnion **earlier** in the sampling season.

> Table 11: Turbidity

Table 11 in Appendix B lists the current year and historic data for inlake and tributary turbidity. Turbidity in the water is caused by suspended matter, such as clay, silt, and algae. Water clarity is strongly influenced by turbidity. Please refer to page 19 of the "Other Monitoring Parameters" section of this report for a more detailed explanation.

The turbidity of the hypolimnion (lower layer) sample was slightly elevated on the **July** sampling event. This suggests that the lake/pond bottom may have been disturbed by the anchor or by the Kemmerer Bottle while sampling. When the lake/pond bottom is

disturbed, sediment, which typically contains attached phosphorus, is released into the water column. When collecting the hypolimnion sample, please check to make sure that there is no sediment in the Kemmerer Bottle before filling the sample bottles.

NOTES

➤ **Biologist's Note (7/25/02):** Holman Inlet looked like an oil spill on the surface. A film which resembled silver pain was observed on the surface of the water near the dock. It is likely that this was really an iron bacteria sheen. At Tommila Inlet, there was brown pollen on the surface of the eater. Little Rock Inlet – culvert is new, and it was dry.

USEFUL RESOURCES

Changes to the Comprehensive Shoreland Protection Act: 2001 Legislative Session, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/sp/sp-8.htm

Cyanobacteria in New Hampshire Waters Potential Dangers of Blue-Green Algae Blooms, NHDES Fact Sheet, (603) 271-3505, or www.des.state.nh.us/factsheets/wmb/wmb-10.htm

The Lake Pocket Book. Prepared by The Terrene Institute, 2000. (internet: www.terrene.org, phone 800-726-4853)

Organizing Lake Users: A Practical Guide. Written by Gretchen Flock, Judith Taggart, and Harvey Olem. Copies are available form the Terrene Institute (internet: www.terrene.org, phone 800-726-4853)

Proper Lawn Care in the Protected Shoreland: The Comprehensive Shoreland Protection Act, WD-SP-2, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/sp/sp-2.htm

Sand Dumping - Beach Construction, WD-BB-15, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-15.htm

Use of Lakes or Streams for Domestic Water Supply, WD-WSEB-1-11, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/ws/ws-1-11.htm


Water Milfoil, WD-BB-1, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-1.htm


Weed Watchers: An Association to Halt the Spread of Exotic Aquatic Plants, WD-BB-4, NHDES Fact Sheet, (603) 271-3503 or www.des.state.nh.us/factsheets/bb/bb-4.htm

Appendix A: Graphs

Rockwood Pond, Fitzwilliam

Figure 1. Monthly and Historical Chlorophyll-a Results

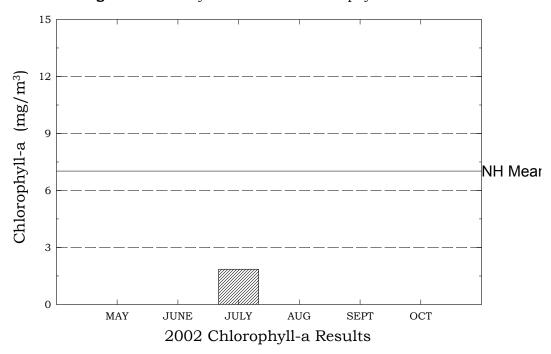

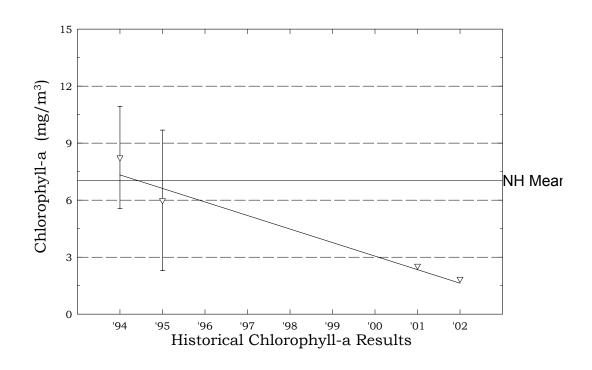

Rockwood Pond, Fitzwilliam

